



Standard

Change-Makers, Inc.

P.O. Box 36550

Indianapolis, IN 46236-0550

3130 N. Mitthoeffer Road

Indianapolis, IN 46235-2400

1-800-968-6955

Phone: (317) 899-6966

Fax: (317) 899-6977

F50-BILL DISPENSER

Fujitsu™ Single Note Operation Manual

Part #8M00503 Rev. 1

For Maintenance Purposes Only

F50 - BILL DISPENSER UNIT OPERATOR'S GUIDE

FUJITSU KIDEN

CONTENTS

CHAPTER 1	OUTLINE	1 - 1
1.1	Device Configuration	1 - 1
CHAPTER 2	F50-BDU	2 - 1
2.1	F50-BDU (Part No.: KD11078-B002)	2 - 1
2.1.1	Parts	2 - 1
2.1.2	Loading bills	2 - 3
2.1.3	Care instructions of bills before loading	2 - 5
CHAPTER 3	REMOVE LEFT BILLS	3 - 1
3.1	How to remove a jammed bill	3 - 1
3.1.1	How to remove the jam on the transportation pathway	3 - 1
3.1.2	How to remove jammed bill at dispensing area	3 - 3

CHAPTER 1 OUTLINE

1.1. Device Configuration

The Figure I-1-1 is the photo image of the F50-bill dispenser unit.

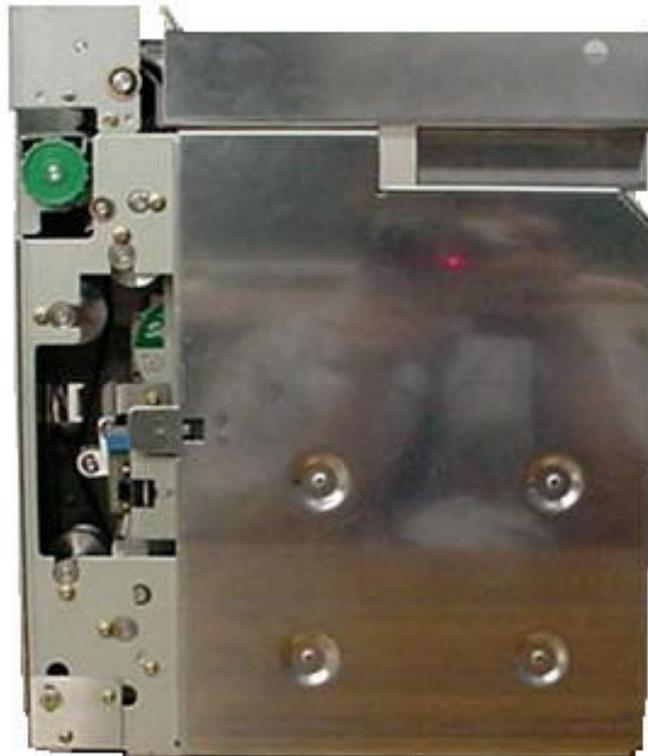


Figure I-1-1

Bill capacity : 1,500mm(max)

(ex: 1,000 USD notes for teller fit, 1,200 USD notes for brand-new notes)

Number of dispensing per transaction : 20sheets (max)

CHAPTER 2 F50-BDU

2.1. F50-BDU (Part No.: KD11078-B002)

2.1.1 Parts

Door:	Door for F50-BDU
Reject area:	Storage are for rejected bills
Tray:	Exit tray
Manual knob:	Manual knob for jammed bill removal
Pressure unit:	Bill pressure mechanism

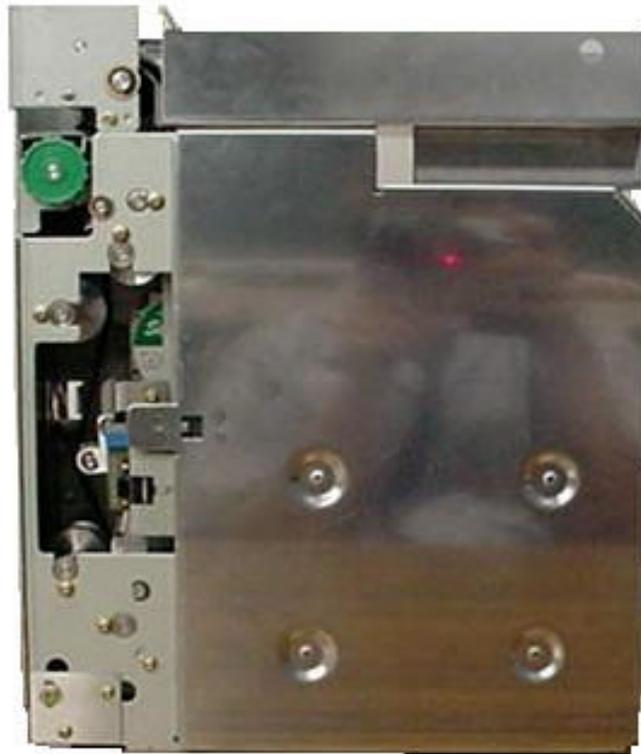


Figure I-2-1

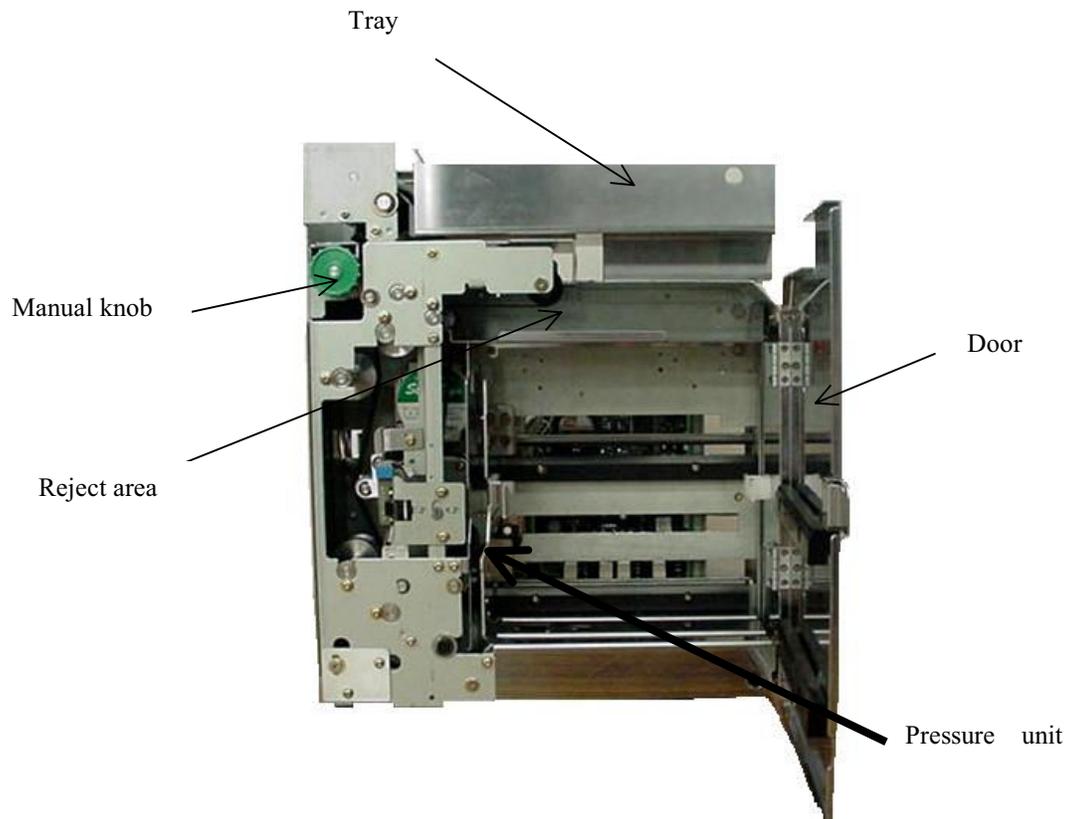


Figure I-2-2

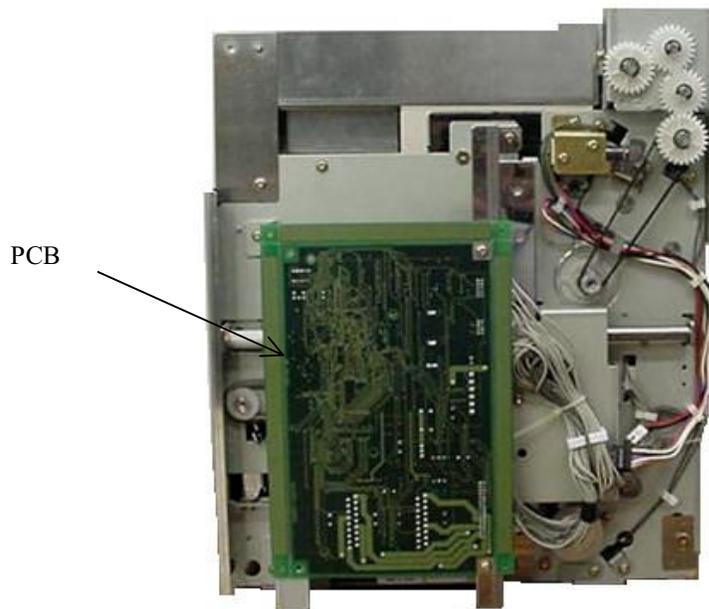


Figure I-2-3

2.1.2 Loading bills

Hold green colored handle(bill holder handle) and slides the bill holder until it locks.

Note : Ensure that Pressure unit is completely locked.

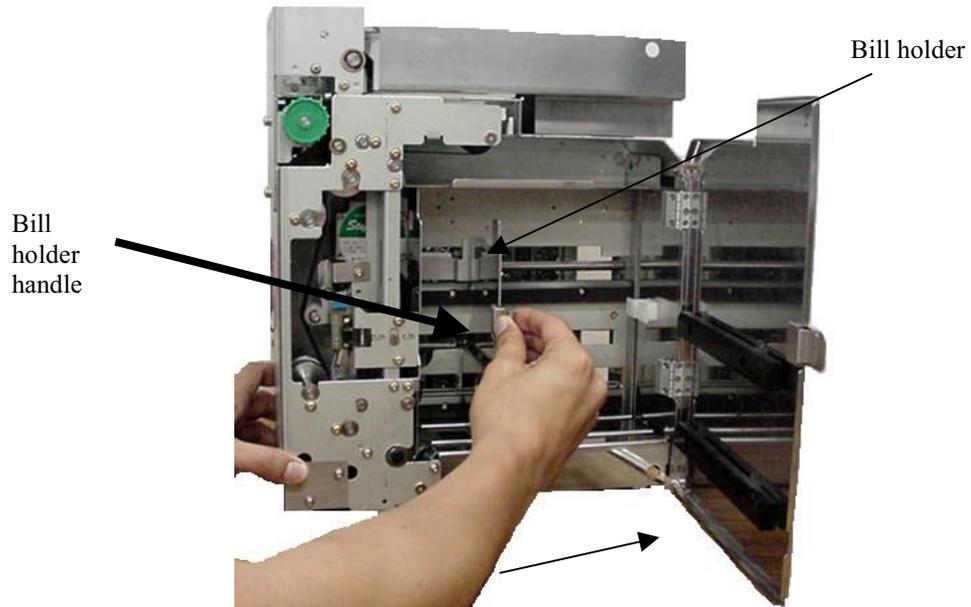


Figure I-2-4

(1) Load bills

Note : Jog a stack of bills and set.

Max loading capacity is 1,200 USD notes for brand-new notes.

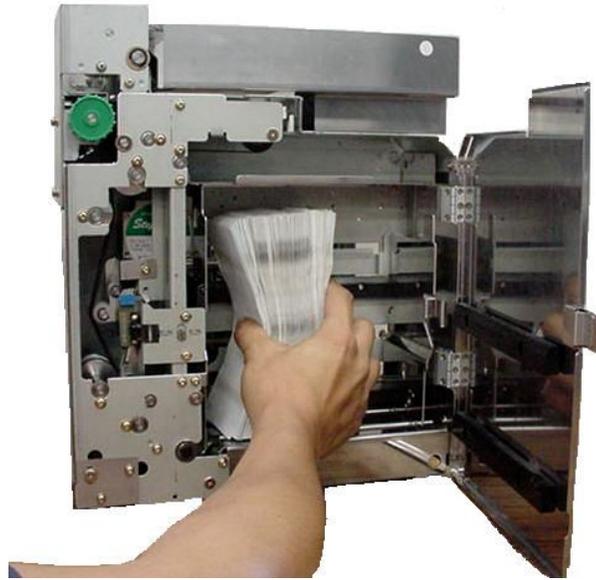


Figure I-2-5

(2) Hold the bill holder handle, and then slide the bill holder to secure the bills.

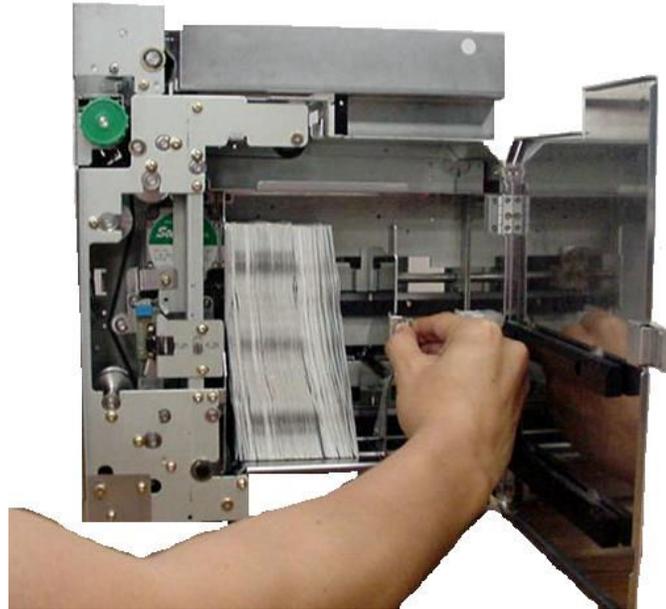


Figure I-2-6

(4) Close the Door completely.


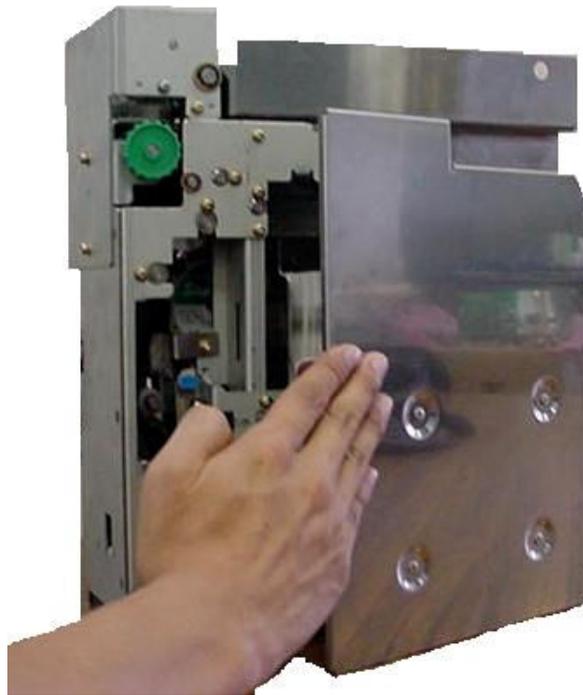


Figure I-2-7


2.1.3 Care instructions of bills before loading

Following care need to be done before loading bills:


- (1) Riffle the stack of bills before loading.

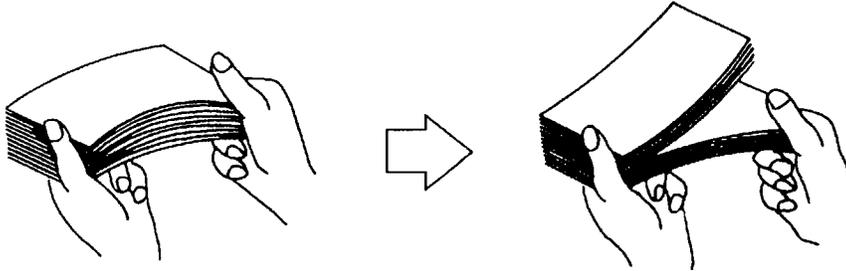


- (2) Find and get rid of shifted bill before loading.

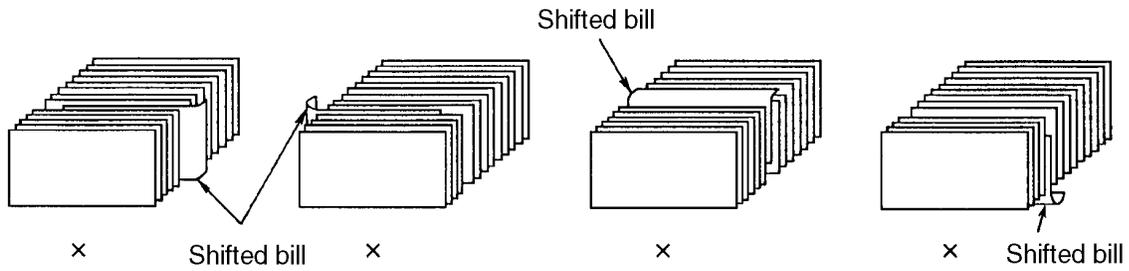


- (3) Load bills in staggered units of 100 sheets so that the stack of bills does not bulge.

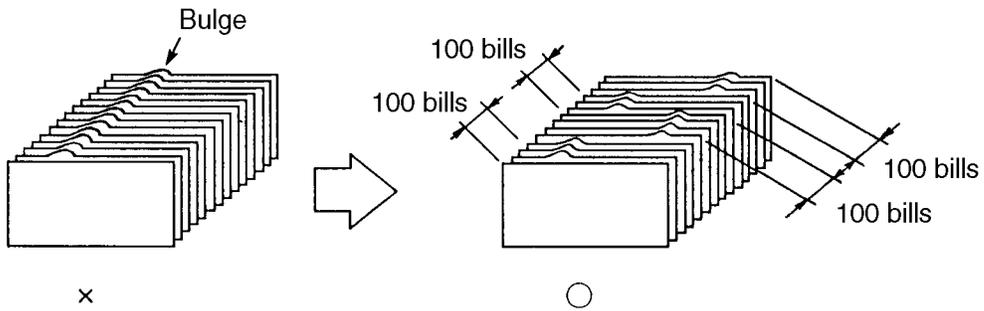

(4) Straighter any folded corners of bills as much as possible before loading.

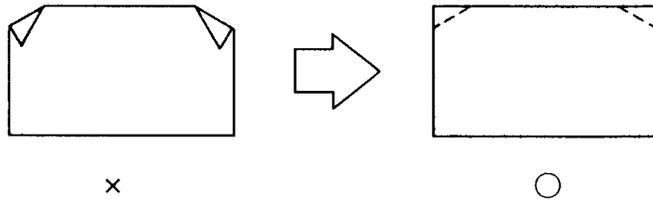

(5) Do not use bills repaired with tape.

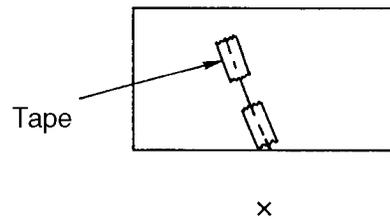

CHAPTER 3 REMOVE LEFT BILLS

3.1. How to remove a jammed bill.

Generally for an abnormal end, device is recovered by the mechanical reset command, however, if device is suspended because of a jam, bill jam in the unit need to be removed by hand.

3.1.1. How to remove the jam on the transportation pathway

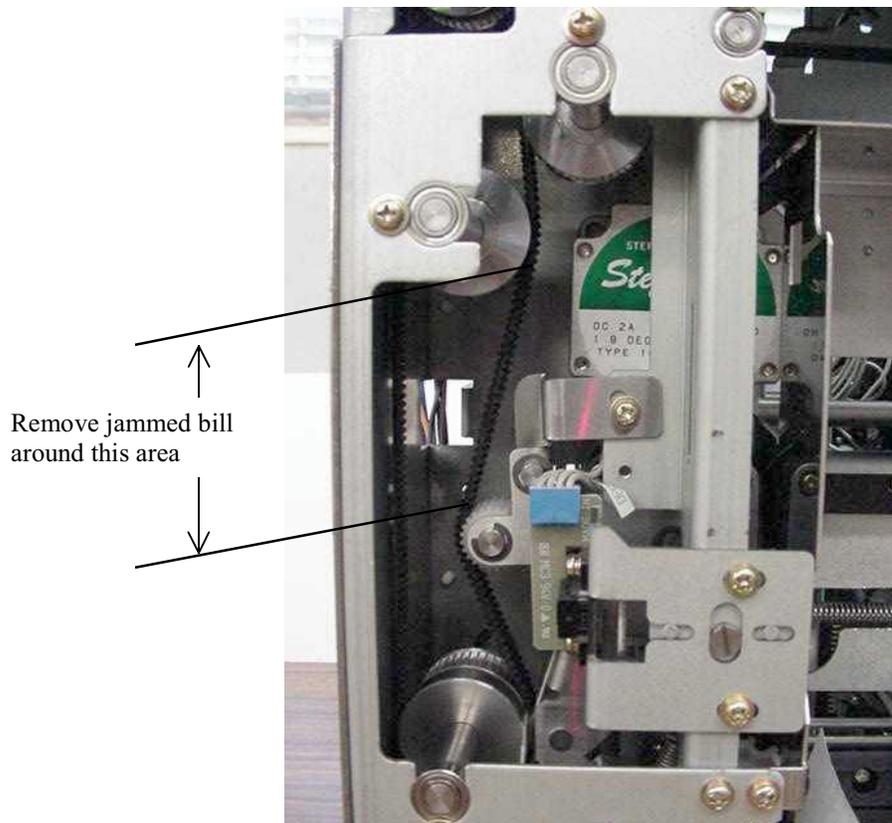


Figure I-3-1

While turning the manual knob, move the jammed bill to the position as figure I-3-1 shows. Then remove jammed bill.

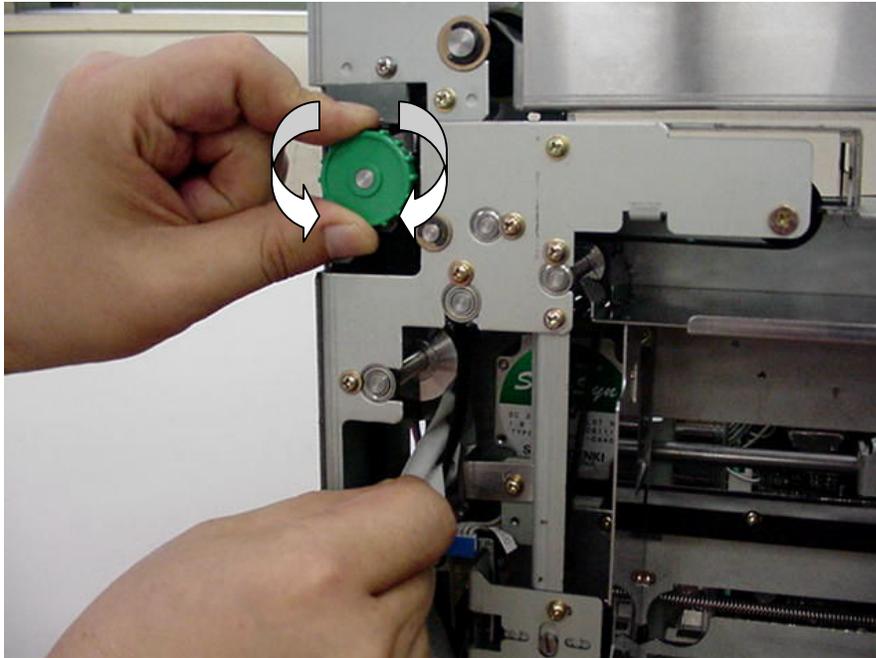


Figure I-3-2

While turning the manual knob, take out a bill slowly.

Note: If you pull the bill by force, belt comes off from the pulley.

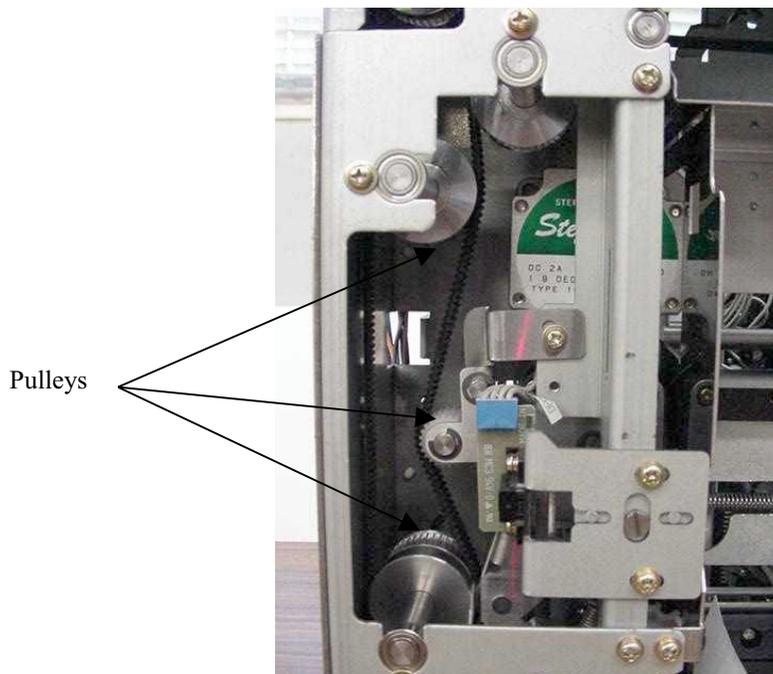


Figure I-3-3

Check pulleys in three places as Figure I-3-3 shows, and ensure that belt isn't off from the belt.

3.1.2. How to remove jammed bill at dispensing area

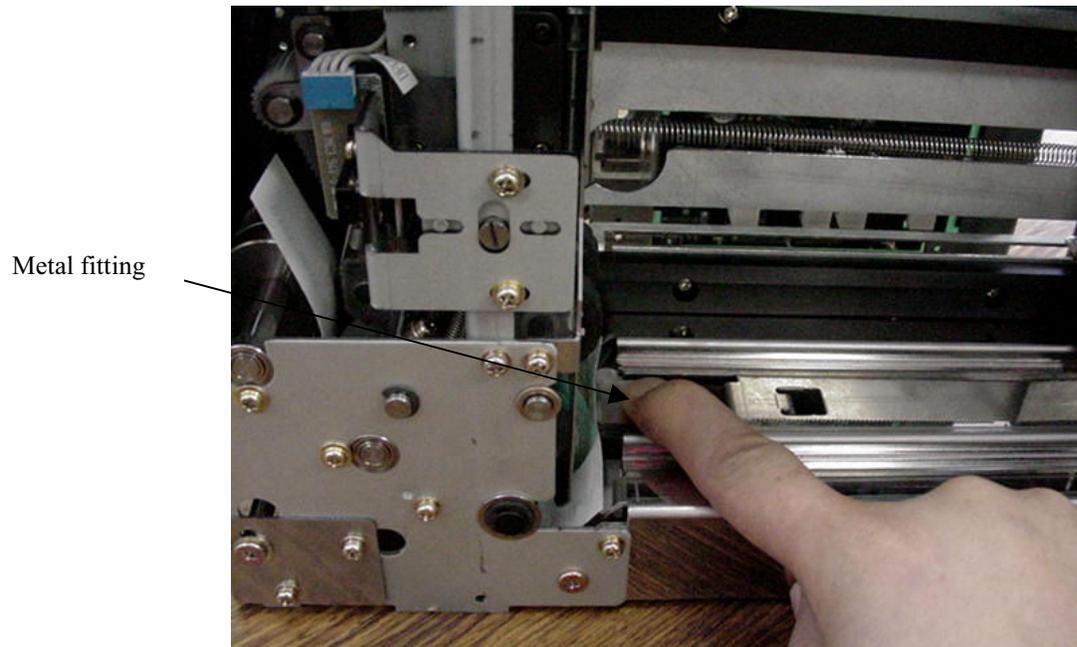


Figure I -3-4

While pressing down the metal fitting of dispensing roller, turn the manual knob and pull jammed bill.



Standard Change-Makers, Inc.

3130 N. Mitthoeffer Road

Indianapolis, IN 46235

Toll Free: 1-800-968-6955

Phone: 317-899-6966

Fax: 317-899-6977

Web Site: www.standardchange.com

FOR SERVICE OR TECHNICAL SUPPORT:

Call: 1-800-968-6955

E-Mail: service@standardchange.com

SALES REPRESENTATIVES:

Eastern U.S.: Dan Wagner

PH: 610.942.4215 EM: dwagner@standardchange.com

East-Central U.S.: Mike Enz

PH: 937.679.6090 EM: menz@standardchange.com

West-Central U.S.: Dale Hughson

PH: 319.239.2481 EM: dhughson@standardchange.com

Western U.S.: Mike Coons & Barb McColly

PH: 800.968.6955 x111 EM: mcoons@standardchange.com

PH: 800.968.6955 x110 EM: bmccolly@standardchange.com

Canada: Paul Thompson

PH: 514.502.0124 EM: sales@standardchange.ca